

Key Observations from Ultrasonic Inspection

- Seeping seams found throughout building on threaded branch lines.
- 3-inch drain pipes running the length of the building showed severe issues..
- Over 65% of piping has interior wall loss of 11% or more.
- Air found within wet pipes on all floors.
- Trapped water found within pipes in the dry systems.

Photos of Fire Sprinkler System Components at Time of Ultrasonic Testing

